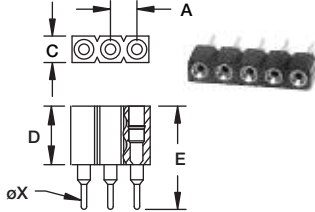
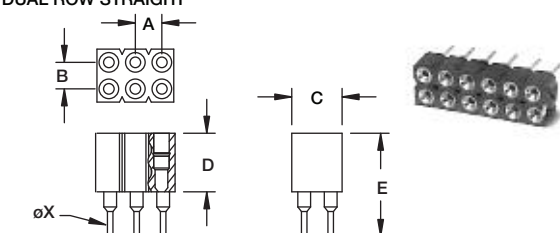
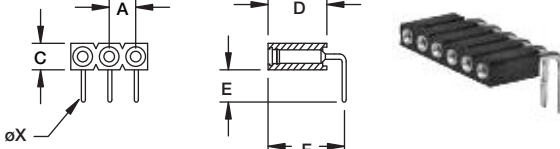
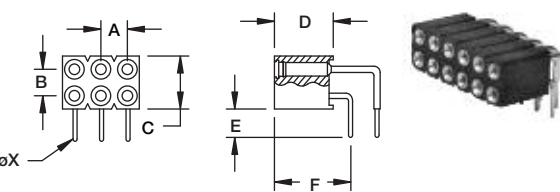
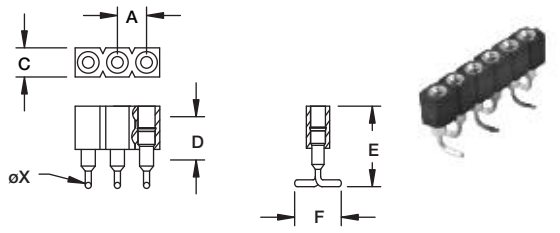
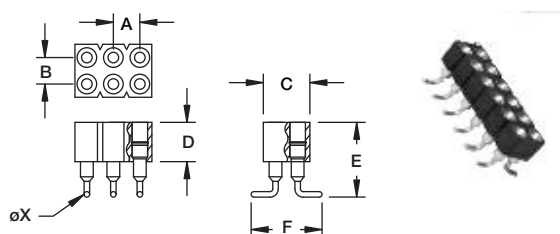


CONFIGURATIONS	.039 [1.00] Pitch	.050 [1.27] Pitch	.078 [2.00] Pitch	.100 [2.54] Pitch
SINGLE ROW STRAIGHT 	1SMC-1-XX-1-GT A = .039 [1.00] C = .086 [2.20] D = .098 [2.50] E = .197 [5.00] øX = .015 [0.40] POSITIONS: 1 THRU 40	.050 [1.27] Pitch HSMC-1-XX-1-GT A = .050 [1.27] C = .086 [2.20] D = .161 [4.10] E = .252 [6.40] øX = .018 [0.46] POSITIONS: 1 THRU 40	.078 [2.00] Pitch 2SMC-1-XX-1-GT A = .078 [2.00] C = .086 [2.20] D = .110 [2.80] E = .291 [7.40] øX = .021 [0.53] POSITIONS: 1 THRU 40	.100 [2.54] Pitch SMC-1-XX-1-GT A = .100 [2.54] C = .100 [2.54] D = .118 [3.00] E = .292 [7.43] øX = .020 [0.51] POSITIONS: 1 THRU 40
	DUAL ROW STRAIGHT 	.050 [1.27] Pitch HSMC-2-XX-1-GT A = .050 [1.27] B = .050 [1.27] C = .128 [3.25] D = .161 [4.10] E = .252 [6.40] øX = .018 [0.46] POSITIONS: 2 THRU 80	.078 [2.00] Pitch 2SMC-2-XX-1-GT A = .078 [2.00] B = .078 [2.00] C = .165 [4.20] D = .110 [2.80] E = .291 [7.40] øX = .021 [0.53] POSITIONS: 2 THRU 80	.100 [2.54] Pitch SMC-2-XX-1-GT A = .100 [2.54] B = .100 [2.54] C = .200 [5.08] D = .118 [3.00] E = .292 [7.43] øX = .020 [0.51] POSITIONS: 2 THRU 80
SINGLE ROW RIGHT ANGLE 	.050 [1.27] Pitch HSMC-1R-XX-1-GT A = .050 [1.27] C = .086 [2.20] D = .161 [4.10] E = .118 [3.00] F = .208 [5.30] øX = .018 [0.46] POSITIONS: 1 THRU 40	.078 [2.00] Pitch 2SMC-1R-XX-1-GT A = .078 [2.00] C = .086 [2.20] D = .110 [2.80] E = .126 [3.20] F = .220 [5.60] øX = .021 [0.53] POSITIONS: 1 THRU 40	.100 [2.54] Pitch SMC-1R-XX-1-GT A = .100 [2.54] C = .100 [2.54] D = .118 [3.00] E = .126 [3.20] F = .220 [5.60] øX = .024 [0.62] POSITIONS: 1 THRU 40	
	DUAL ROW RIGHT ANGLE 	.050 [1.27] Pitch HSMC-2R-XX-1-GT A = .050 [1.27] B = .050 [1.27] C = .128 [3.25] D = .161 [4.10] E = .118 [3.00] F = .208 [5.30] øX = .018 [0.46] POSITIONS: 2 THRU 80	.078 [2.00] Pitch 2SMC-2R-XX-1-GT A = .078 [2.00] B = .078 [2.00] C = .165 [4.20] D = .110 [2.80] E = .126 [3.20] F = .220 [5.60] øX = .021 [0.53] POSITIONS: 2 THRU 80	.100 [2.54] Pitch SMC-2R-XX-1-GT A = .100 [2.54] B = .100 [2.54] C = .200 [5.08] D = .118 [3.00] E = .126 [3.20] F = .220 [5.60] øX = .024 [0.62] POSITIONS: 2 THRU 80
SINGLE ROW SURFACE MOUNT 	.050 [1.27] Pitch HSMC-1-XX-1-GT-SMT A = .050 [1.27] C = .086 [2.20] D = .161 [4.10] E = .204 [5.20] F = .134 [3.40] øX = .018 [0.46] POSITIONS: 1 THRU 40	.078 [2.00] Pitch 2SMC-1-XX-1-GT-SMT A = .078 [2.00] B = .086 [2.20] D = .110 [2.80] E = .228 [5.80] F = .173 [4.40] øX = .021 [0.53] POSITIONS: 1 THRU 40	.100 [2.54] Pitch SMC-1-XX-1-GT-SMT A = .100 [2.54] C = .100 [2.54] D = .118 [3.00] E = .220 [5.60] F = .182 [4.64] øX = .024 [0.62] POSITIONS: 1 THRU 40	
	DUAL ROW SURFACE MOUNT 	.050 [1.27] Pitch HSMC-2-XX-1-GT-SMT A = .050 [1.27] B = .050 [1.27] C = .128 [3.25] D = .161 [4.10] E = .204 [5.20] F = .193 [4.90] øX = .018 [0.46] POSITIONS: 2 THRU 80	.078 [2.00] Pitch 2SMC-2-XX-1-GT-SMT A = .078 [2.00] B = .078 [2.00] C = .165 [4.20] D = .110 [2.80] E = .228 [5.80] F = .252 [6.40] øX = .021 [0.53] POSITIONS: 2 THRU 80	.100 [2.54] Pitch SMC-2-XX-1-GT-SMT A = .100 [2.54] B = .100 [2.54] C = .200 [5.08] D = .118 [3.00] E = .220 [5.60] F = .282 [7.18] øX = .024 [0.62] POSITIONS: 2 THRU 80